


K-SML10 Installation



Connections




2 PHASE SQUIRREL CAGE MOTOR DELTA

Line Connections L1, L2 and L3 to be connected to U1, V1 and W1 respectively






3 PHASE SQUIRREL CAGE MOTOR STAR

Line Connections L1, L2 and L3 to be connected to U1, V1 and W1 respectively

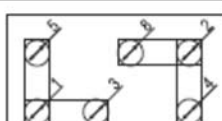

SINGLE PHASE MOTOR

Join Leads: 1, 3 and 5 together and supply incoming line L1 to these three.
Join leads: 2, 4 and 8 together and supply incoming line L2 to these three.
To reverse direction interchange leads 5 and 8

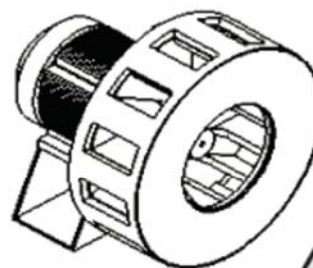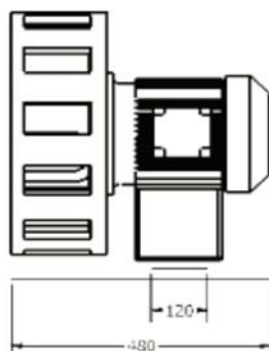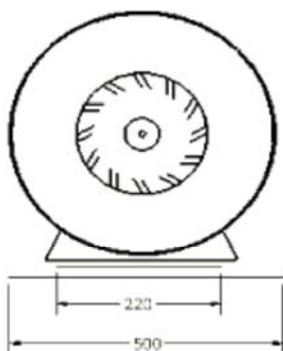

Rated Output	4 kW		
Voltage	220/230	380/415	525/550
Current (A)	N.A.	7.8	5.9
Leads	See connections		
IP Rating	IP 55		

INSTALLATION INSTRUCTIONS

Please Note :

Disconnect from power source to prevent electrical shock before installing or servicing unit.

No liability is accepted for any consequence due to the incorrect use of this document.

Technical specifications of the unit subject to change without prior notice caused by ongoing product engineering.

All dimensions are approximate and subject to change.

Servicing and / or replacements of parts by qualified electricians recommended.

Fitment :

For fitment of unit bolt unit with suitable HT bolts on mounting foot.

Lead connections as indicated above for specific model purchased in motor terminal box.

Contact qualified electrician for correct contactor selection for application or if adding to existing system.

Seal unit with all screws and o-ring again on completion before powering unit up.